



WHITE PAPER

# **Encoders in Inhospitable Environments**

### Contents

lousing Options	ĺ
olation Options	
lexible Shafts	)
Praw Wire Units with Encoders	)
onclusion	3



### WHITE PAPER



# **Encoders in Inhospitable Environments**


Encoders are often used in harsh industrial environments where they can be exposed to the same contaminants other machinery is, including: high volumes of dust, an abundance of moisture, caustic chemicals, even physical damage, where the encoder is knocked around by other equipment. For encoders used in an outdoor environment, they must be able to stand up to extreme weather conditions. In short, encoders need to be able to endure whatever the machinery they're a part of can endure.

In applications that call for frequent washdowns with caustic chemicals, the chemicals can attack the encoder's aluminum housing and exposed parts, which causes corrosion and eventually shortens the life of the encoder.

### **Housing Options**

For protection against corrosion of the housing, shafts, connectors, etc., encoder housings should be made of 6061-T6 or 6063-T6 aluminum with a tough powder-coated finish. This combination provides a rugged unit that is protected against most industrial environments.

A stainless steel housing on an encoder will provide an additional level of corrosion protection where needed.

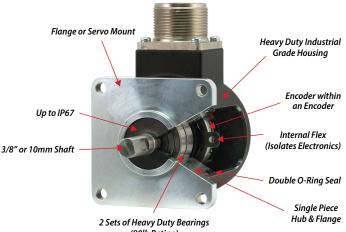

(80lb Ratina)

### **Isolation Options**

For extremely harsh environments, an encoder isolated from the corrosive elements is often the best long-term choice.

#### Model 725i industrial housing

One method of isolation is to place the encoder in a sealed and corrosion-proof enclosure. However, this can be an expensive alternative, and often it makes the unit too large to fit into its application.

A more economical solution is to use a flexible drive shaft and place the encoder in a remote location, out of the corrosive environment. These flexible drive shafts are similar to the speedometer drive cable used in automobiles. They transmit rotary motion around curves, obstacles, etc. The portion of the flexible drive shaft that is exposed to the hostile environment can usually be replaced guicker and more economically than the encoder.





Some of these flexible drive shafts can be obtained with conformal

coatings, which will enhance their life in harsh environments. Or it is usually a simple matter to coat the outer sheath with some type of corrosion resistant compound, such as heavy grease or Cosmoline\* coating. There are many different configurations of flexible drive shafts available, and they are available in any reasonable length. There are a number of manufacturers that carry a complete line of flexible drive shafts, and can provide custom designs for



# **Encoders in Inhospitable Environments**

## **Flexible Shafts**

A few known examples of where these flexible shafts have been used with encoders are in the nuclear industry where the position of valves, rods, etc., in a radioactive environment existed. The radiation would shorten the life of the solid state electronic components of the encoder. By placing the encoder external to the machine environment, the problem was solved.

Another example is a food processing plant where the machinery has to be completely washed down every shift or every few hours. Stainless steel plumbing was used throughout the plant and it was considered "routine maintenance" to completely replace all the plumbing and associated equipment every six months as a matter of course. Naturally, the encoders were replaced along with all the rest of the equipment. When this customer went to the flexible shaft drive to the encoder, he found out that over a period of three years, the encoder was the ONLY item in the plant that was still original. Thousands of dollars were spent replacing stainless steel drive motors, pumps, plumbing, etc., but the encoders were still performing like new.



Torsional windup is one concern when implementing flexible drive shafts. With the proper flexible drive shaft (configuration, length, etc.), and correct installation (proper bend radius, sealing), windup can be greatly reduced. The migration of liquids inside the inner sheath of the flexible cable can also cause problems. Proper sealing methods on each end of the cable solve this issue. Remember that liquids flow down-hill, so be sure to provide a drain loop at the end of the cable, or have the encoder elevated above the rest of the machine.

### **Draw Wire Units with Encoders**

Using a draw wire unit in conjunction with an encoder allows for the simple solution of keeping the encoder at a distance from the caustic environment. If the draw wire itself is made from stainless steel, the encoder can be placed away from the heat, washdown, or caustic chemicals that cause the corrosive environment.

In the past, many of these solutions have involved a simple coil pot with a potentiometer, providing limited data on the motion control. Using an encoder for the motion feedback provides incremental or absolute motion feedback, providing the controller with much better, more complete data to control the motion.

## Conclusion

If you still have questions about output, or anything else encoder-related, contact EPC. When you call EPC, you talk to engineers and encoder experts who can answer your toughest encoder questions. Contact EPC today to get the information you need.



Model LCX draw wires